

RECEIVED

FEB 03 1999

STATE OF OREGON
WATER SUPPLY WELL REPORT
(as required by ORS 337.765)

Instructions for completing this report are on the last page of this form.

WATER RESOURCES DEPT.
SALEM, OREGON

WELL I.D. # L 14904

START CARD # 102393

(1) OWNER:

Well Number _____

Name Oregon Flowers, Inc.

Address P.O. Box 311

City Aurora, State OR Zip 97002

(2) TYPE OF WORK

Partial

☐ New Well ☐ Deepening ☒ Alteration (repair/recondition) ☒ Abandonment

(3) DRILL METHOD: No Drilling

☐ Rotary Air ☐ Rotary Mud ☐ Cable ☐ Auger

☒ Other Pump rig & rotary to pull liner

(4) PROPOSED USE:

☐ Domestic ☐ Community ☐ Industrial ☐ Irrigation

☐ Thermal ☐ Injection ☐ Livestock ☐ Other

(5) BORE HOLE CONSTRUCTION:

Special Construction approval ☒ Yes ☐ No Depth of Completed Well 991 ft.

Explosives used ☐ Yes ☒ No Type _____ Amount _____

HOLE

SEAL

Diameter From To Material From To Sacks or pounds

No Changes Made

How was seal placed: Method ☐ A ☐ B ☐ C ☐ D ☐ E

☐ Other

Backfill placed from _____ ft. to _____ ft. Material _____

Gravel placed from _____ ft. to _____ ft. Size of gravel _____

(6) CASING/LINER:

	Diameter	From	To	Gauge	Steel	Plastic	Welded	Threaded
Casing:	Existing:				☐	☐	☐	☐
	10	+2	905	.250	☒	☐	☒	☐
					☐	☐	☐	☐
					☐	☐	☐	☐
					☐	☐	☐	☐
Liner:	All Removed				☐	☐	☐	☐
					☐	☐	☐	☐

Final location of shoe(s) _____

(7) PERFORATIONS/SCREENS: All removed w/liner

☐ Perforations

Method _____

☐ Screens

Type _____

Material _____

From	To	Slot size	Number	Diameter	Tele/pipe size	Casing	Liner
						☐	☐
						☐	☐
						☐	☐
						☐	☐

(8) WELL TESTS: Minimum testing time is 1 hour

☒ Pump

☐ Bailor

☐ Air

☐ Flowing
☐ Artesian

Yield gal/min

Drawdown

Drill stem at

Time

SEE ATTACHED GRAPHS

1 hr.

Temperature of water 68 ° Depth Artesian Flow Found _____

Was a water analysis done? ☐ Yes By whom _____

Did any strata contain water not suitable for intended use? ☐ Too little

☐ Salty ☐ Muddy ☐ Odor ☐ Colored ☐ Other _____

Depth of strata: _____

(9) LOCATION OF WELL by legal description:

County Marion Latitude _____ Longitude _____

Township 4S N or S Range 1W E or W. WM.

Section 11 SE 1/4 NE 1/4

Tax Lot 900 Lot _____ Block _____ Subdivision _____

Street Address of Well (or nearest address) 14408 Keil Rd NE

Aurora, OR 97002

(10) STATIC WATER LEVEL:

97 ft. below land surface.

Date 12-16-98

Artesian pressure _____ lb. per square inch. Date _____

(11) WATER BEARING ZONES:

Depth at which water was first found *

From	To	Estimated Flow Rate	SWL
N/A No Drilling--See Original Log			

(12) WELL LOG:

Ground Elevation Approx. 190 msl

Material	From	To	SWL
No Drilling			
Work consisted of:			
1. Removal of all liner			
2. Geophysical & video logging			
3. Abandonment of lower borehole:			
pea gravel w/bentonite (3/8) 1020 1097			
30 sks each			
cement grout 5 sks	1017	1020	
pea gravel & sand	1000	1017	
cement grout 5 sks	991	1000	
4. Test pumping			

Date started 10-9-98

Completed 12-20-98

(unbonded) Water Well Constructor Certification:

I certify that the work I performed on the construction, alteration, or abandonment of this well is in compliance with Oregon water supply well construction standards. Materials used and information reported above are true to the best of my knowledge and belief.

Signed _____ WWC Number 1367 Date 1-29-99

(bonded) Water Well Constructor Certification:

I accept responsibility for the construction, alteration, or abandonment work performed on this well during the construction dates reported above. All work performed during this time is in compliance with Oregon water supply well construction standards. This report is true to the best of my knowledge and belief.

Signed _____ WWC Number 649 Date 1-29-99


RECEIVED

OREGON FLOWERS

12/16/98 Test @ 155 GPM - SWL 95'loc

FEB 03 1999

**WATER RESOURCES DEPT.
SALEM, OREGON**

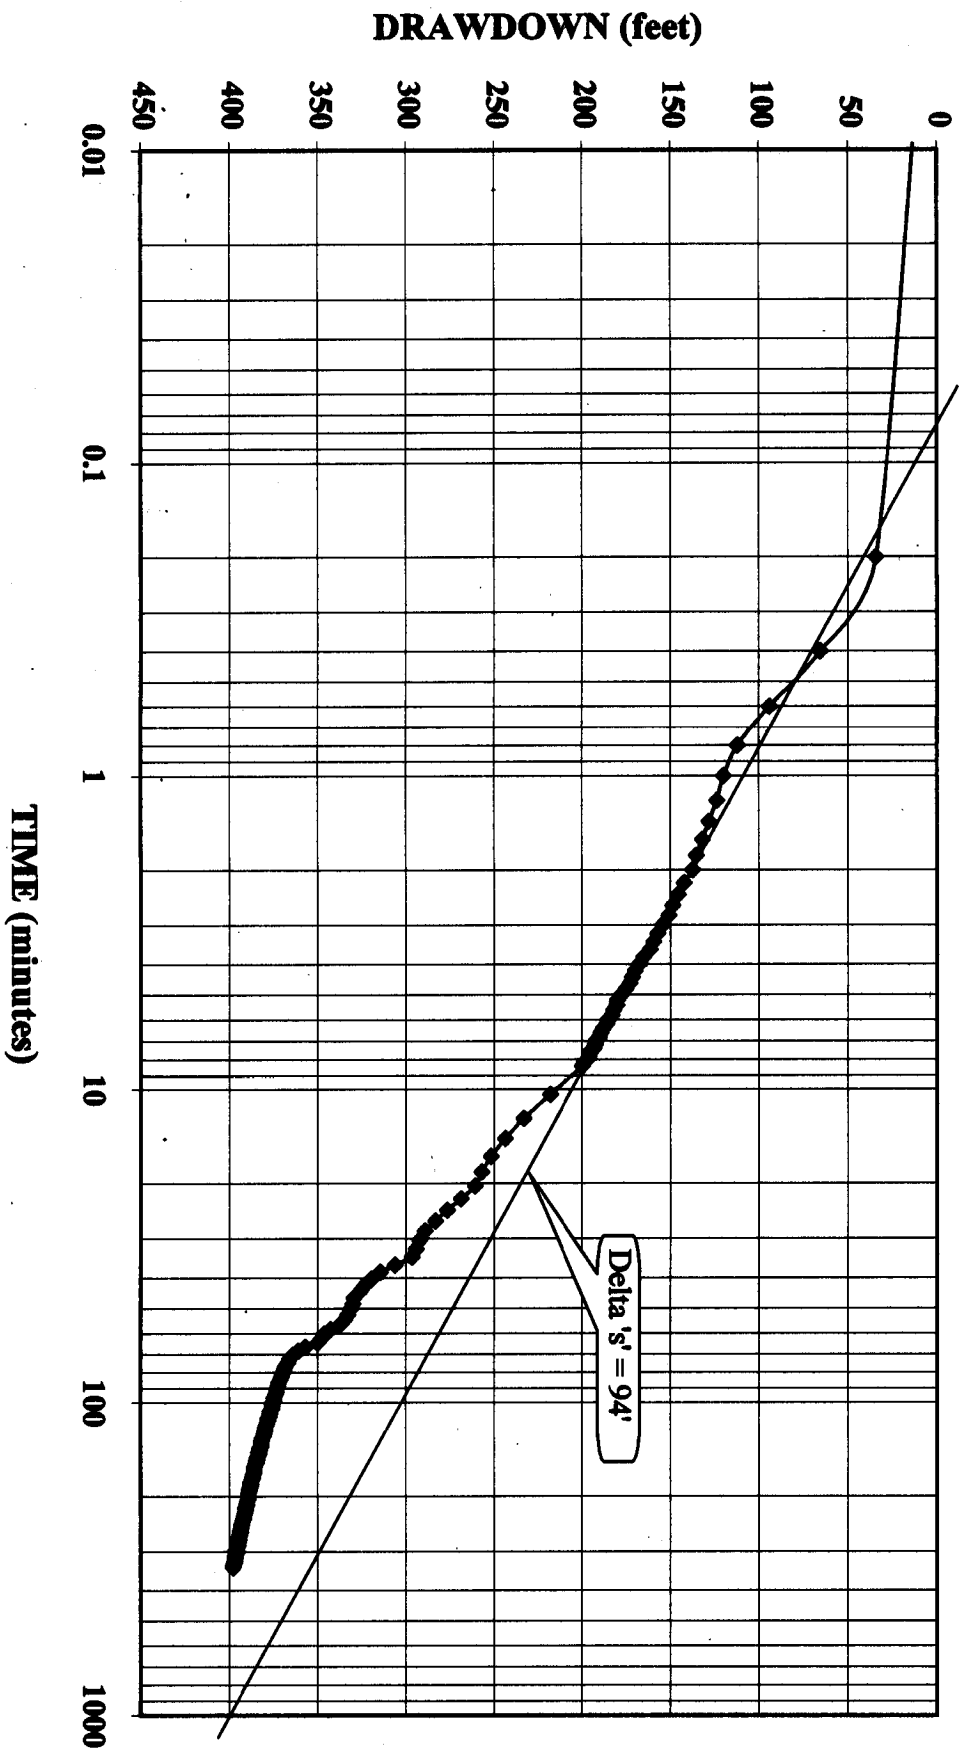


RECEIVED

FEB 03 1999

**WATER RESOURCES DEPT.
SALEM, OREGON**

OREGON FLOWERS

12/16/98 Recovery

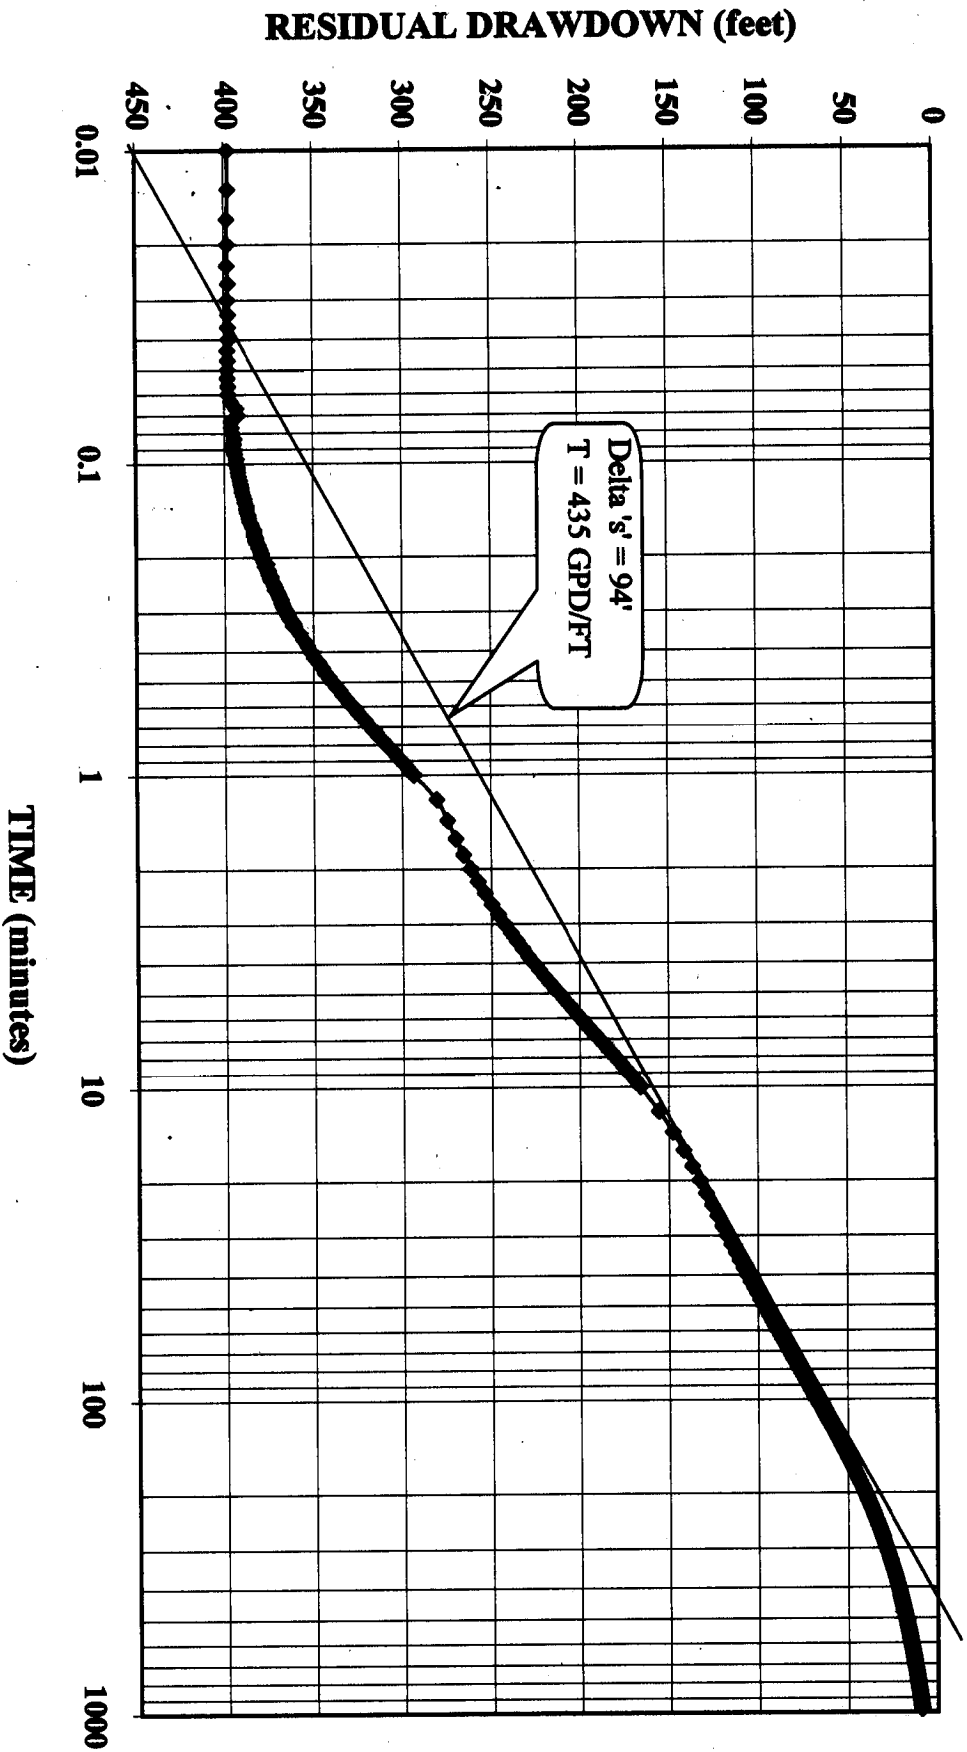


RECEIVED

FEB 03 1999

WATER RESOURCES DEPT.
SALEM, OREGON

OREGON FLOWERS

12/17/98 Test @ 120 GPM - SWL 105'toc

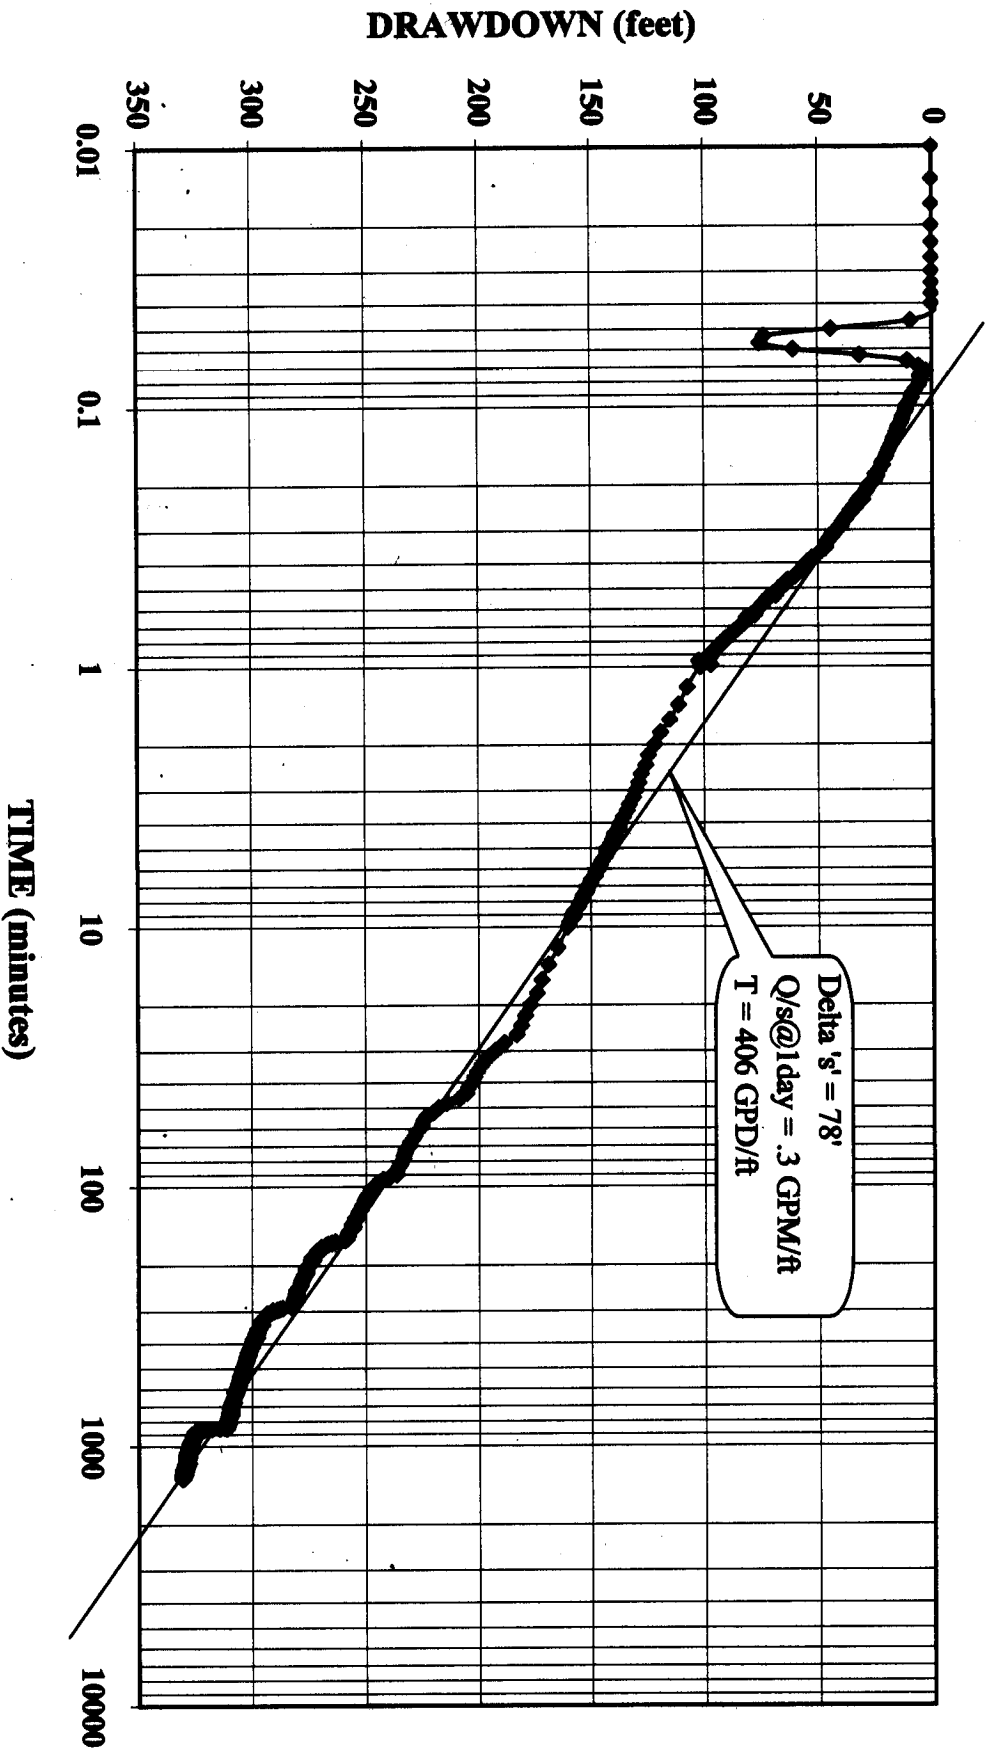

RECEIVED

FEB 03 1999

**WATER RESOURCES DEPT.
SALEM, OREGON**

OREGON FLOWERS

12-18-98 Recovery

