

STATE OF OREGON
WATER WELL REPORT
(as required by ORS 537.765)

LINN 54777
LINN 54777

Linn
54777

(START CARD) # 31662

(1) OWNER:

Name Jim Frank Well Number _____
Address 38903 Ridge Dr
City Scio State Or Zip _____

(2) TYPE OF WORK:

☒ New Well ☐ Deepen ☐ Recondition ☐ Abandon

(3) DRILL METHOD:

☒ Rotary Air ☐ Rotary Mud ☐ Cable
☐ Other _____

(4) PROPOSED USE:

☒ Domestic ☐ Community ☐ Industrial ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

(5) BORE HOLE CONSTRUCTION:

Special Construction approval ☐ Yes ☒ No Depth of Completed Well 270 ft.
Explosives used ☐ Yes ☒ No Type _____ Amount _____

HOLE			SEAL			Amount sacks or pounds
Diameter	From	To	Material	From	To	
10"	0	19	Cracked	0	19	4
4"	19	270				

How was seal placed: Method ☐ A ☐ B ☒ C ☐ D ☐ E
☐ Other _____

Backfill placed from _____ ft. to _____ ft. Material _____

Gravel placed from _____ ft. to _____ ft. Size of gravel _____

(6) CASING/LINER:

	Diameter	From	To	Gauge	Steel	Plastic	Welded	Threaded
Casing	4"	+1	19	20	☒	☐	☐	☐
Liner	4"	0	270	16	☐	☐	☐	☐

Final location of shoe(s) _____

(7) PERFORATIONS/SCREENS:

☒ Perforations Method Sk. 1 Saw
☐ Screens Type _____ Material _____

From	To	Slot size	Number	Diameter	Tele/pipe size	Casing	Liner
110	270	1/4 x 7			4"	☐	☒

(8) WELL TESTS: Minimum testing time is 1 hour

☐ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal/min	Drawdown	Drill stem at	Time
60		265'	1 hr.

Temperature of Water 57° Depth Artesian Flow Found _____

Was a water analysis done? ☐ Yes By whom _____

Did any strata contain water not suitable for intended use? ☐ Too little

☐ Salty ☐ Muddy ☐ Odor ☐ Colored ☐ Other _____

Depth of strata: _____

(9) LOCATION OF WELL by legal description:

County Linn Latitude _____ Longitude _____
Township 10S N or S. Range 1W E or W. WM
Section 4 N.E. 1/4 SW
Tax Lot 1900 Lot _____ Block _____ Subdivision _____
Street Address of Well (or nearest address) 38903 Ridge Dr.

(10) STATIC WATER LEVEL:

40 ft. below land surface. Date July 27, 1993
Artesian pressure _____ lb. per square inch. Date _____

(11) WATER BEARING ZONES:


Depth at which water was first found _____

From	To	Estimated Flow Rate	SW
170	270	60 G.P.M.	40

(12) WELL LOG:

Ground elevation _____

Material	From	To	SW
Soil	0	2	
Soil & Broken Rock	2	6	
Clay & Broken Rock	6	9	
Rock Hard Black	9	157	
Rock Grey Very Hard	157	170	
Rock Black Broken Heavy/loose	170	270	40

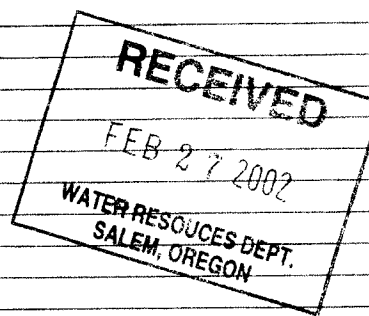

RECEIVED
APR 15 2003
WATER RESOURCES DEPT.
SALEM, OREGON

Date started July 21, 1993 Completed July 27, 1993

(unbonded) Water Well Constructor Certification:

I certify that the work I performed on the construction, alteration, or abandonment of this well is in compliance with Oregon well construction standards. Materials used and information reported above are true to my best knowledge and belief.

WWC Number _____
Signed _____ Date _____

(bonded) Water Well Constructor Certification:

I accept responsibility for the construction, alteration, or abandonment work performed on this well during the construction dates reported above. All work performed during this time is in compliance with Oregon well construction standards. This is true to the best of my knowledge and belief.

WWC Number 25
Signed William J. Hoyle Date July 27, 1993